


AS SEEN FROM REAR

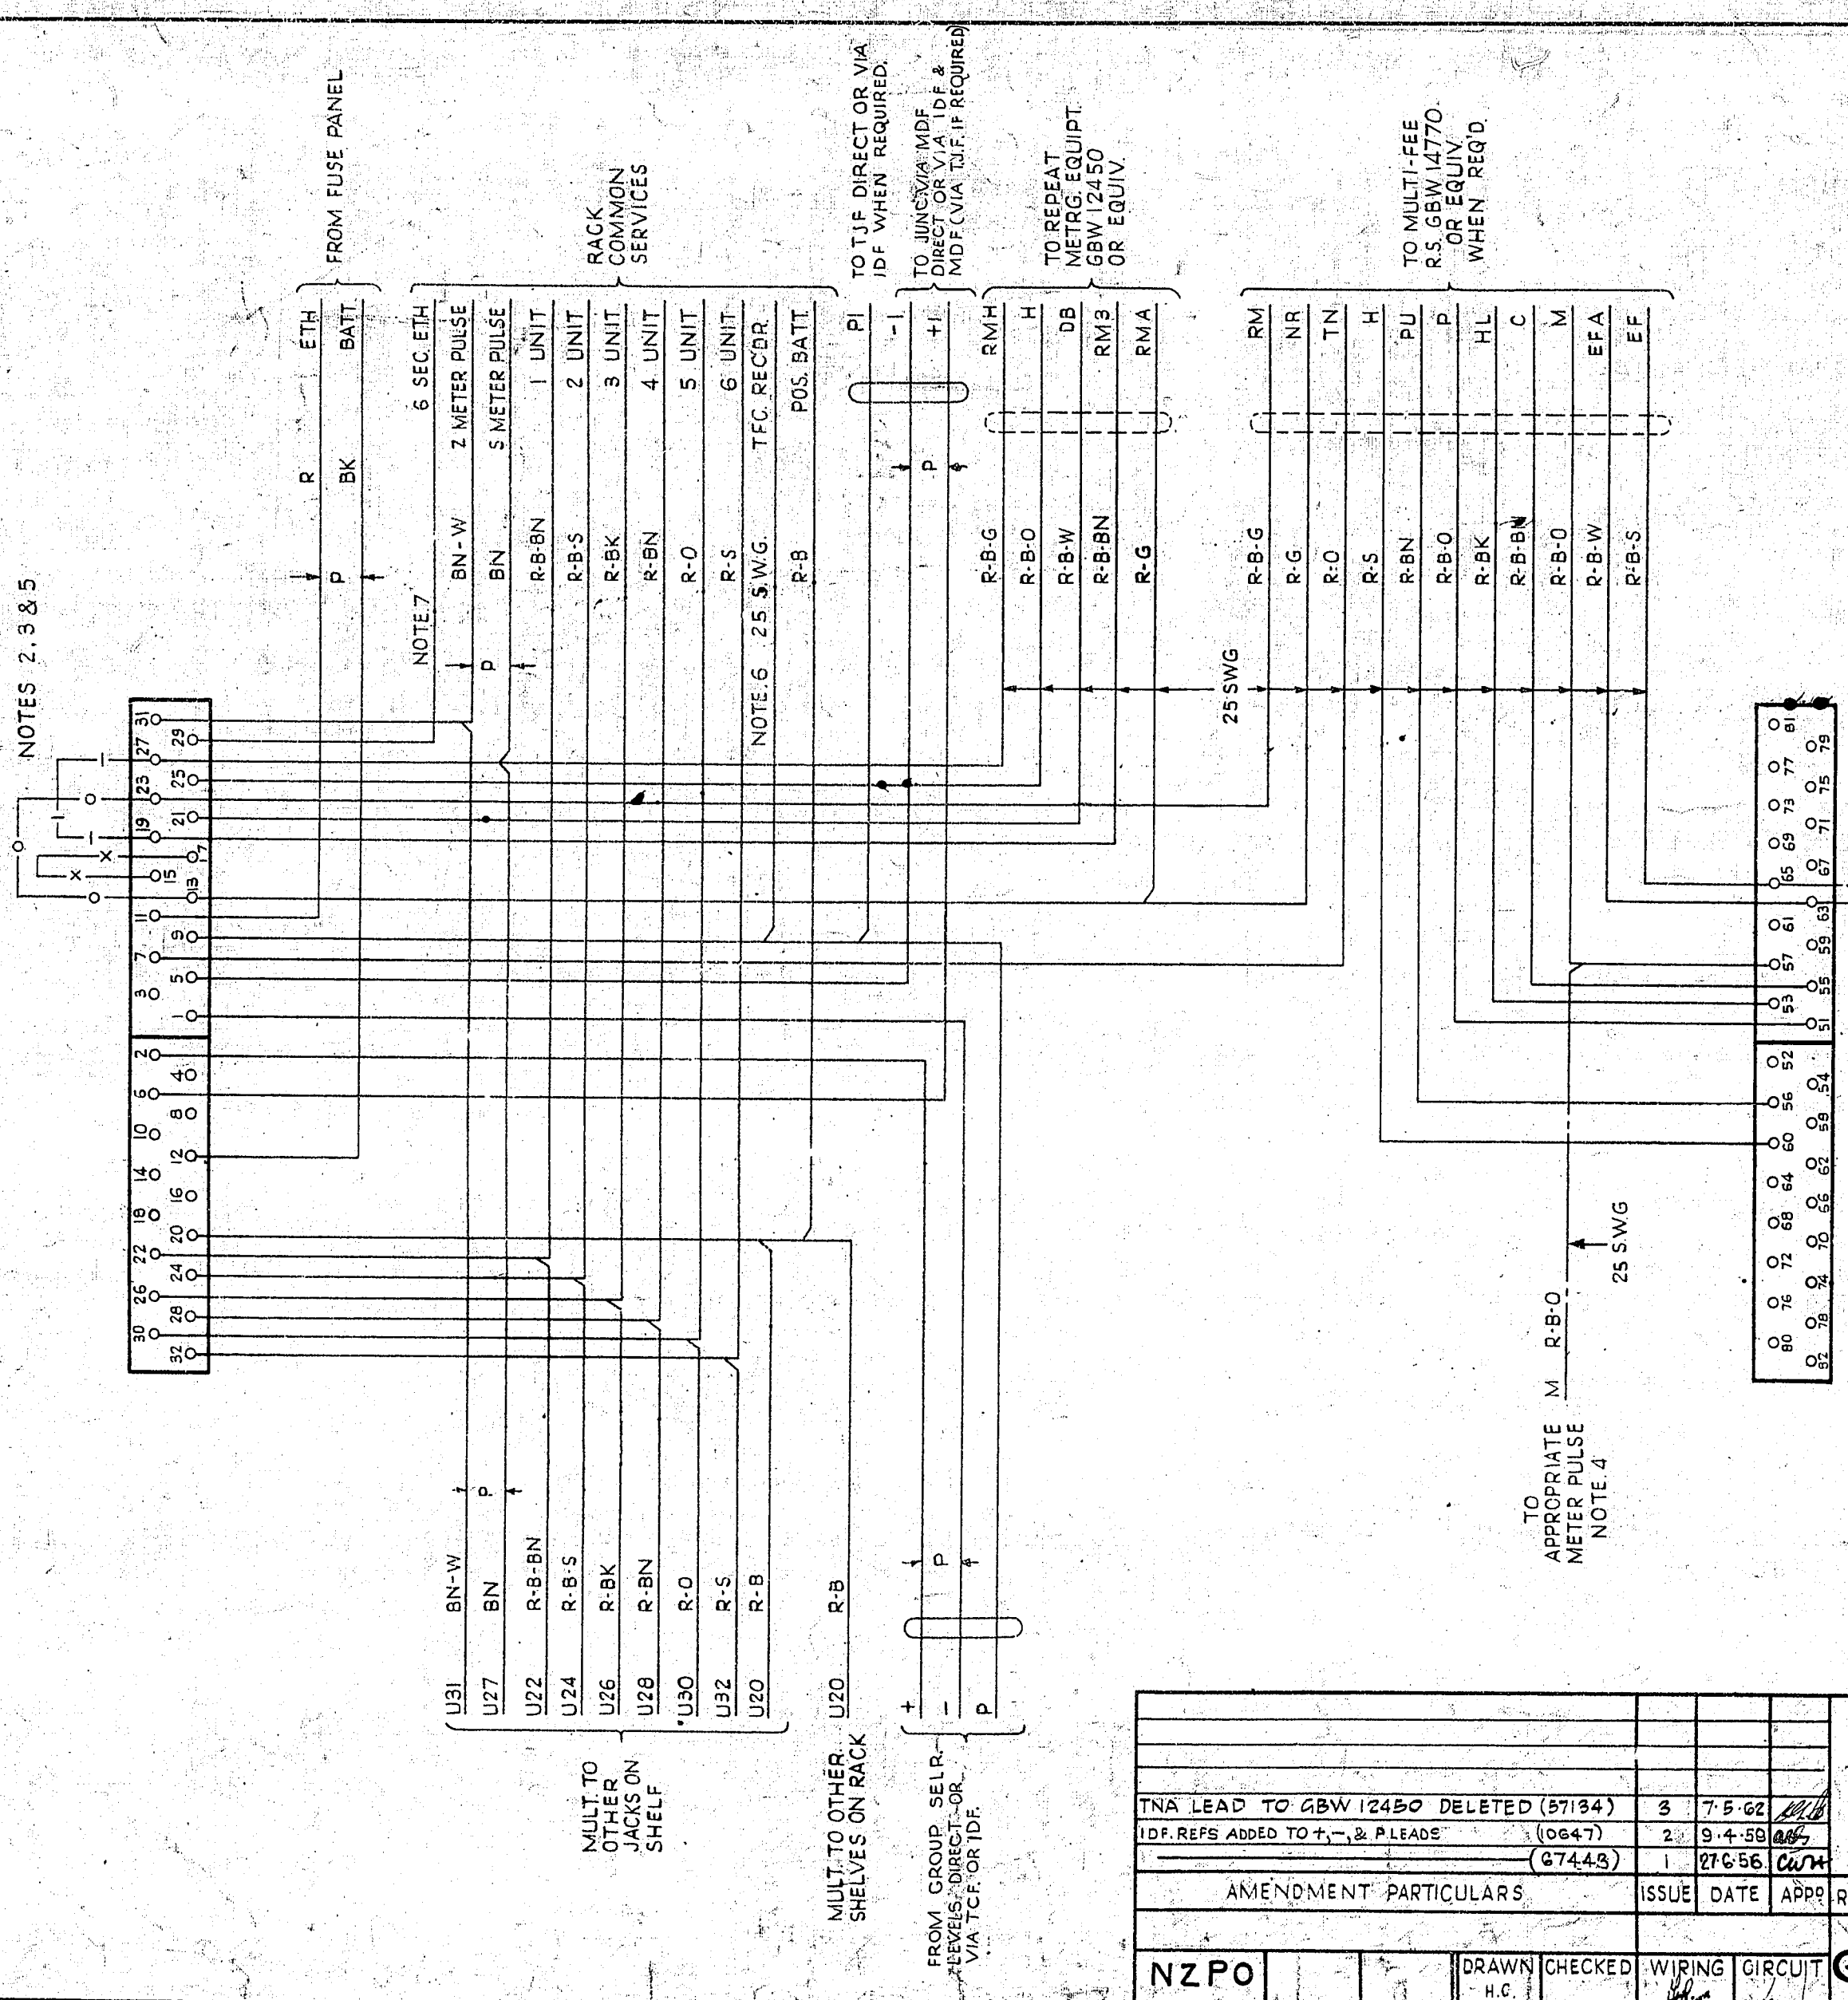

NOTES:

1. SHELF JACK U POINTS 9&11 MAKE CONTACT WHEN RELAY SET IS REMOVED.
2. CUT STRAP SHOWN THUS —x— WHEN THE JUNCTION RESISTANCE IS LESS THAN 200Ω.
3. ADD STRAP SHOWN THUS —o— FOR SINGLE OR FIXED MULTI-FEE METERING WITH TIMED REPETITION.
4. ADD STRAP SHOWN THUS —|— WHEN NO MULTI-FEE R.S. IS EQUIPPED AND CONNECT U57 TO THE APPROPRIATE METER PULSE FOR FIXED FEE.
5. ADD STRAP SHOWN THUS —|— WHEN REPEAT METRG. EQUIPT. IS NOT PROVIDED.
6. COLOURS FOR TFC. RCODR. LEADS: 1ST PAIR OF SHELVES, R-O; 2ND PAIR OF SHELVES, R-G; 3RD PAIR OF SHELVES, R-BN; 4TH PAIR OF SHELVES, R-S; 5TH PAIR OF SHELVES, R-BW; 6TH PAIR OF SHELVES, R-B; 7TH PAIR OF SHELVES, R-O; 8TH PAIR OF SHELVES, R-BK.
7. COLOURS FOR RELAY SETS: 1-10 ON EACH SHELF TO BE: R-O, R-G, R-BN, R-S, R-B-W, R-B-O, R-B-G, R-B-BN, R-B-S, R-BK RESPECTIVELY.
8. ALL WIRING TO BE 22 SWG UNLESS OTHERWISE SPECIFIED.

AMENDMENT PARTICULARS				ISSUE	DATE	APPD	REF. ESIG 2	PARA. 8.0.	50V	W
TNA LEAD TO GBW 12450 DELETED (57134)				3	7.5.62					
IDF. REFS ADDED TO +, -, & P LEADS (0647)				2	9.4.59					
(67443)				1	27.6.56					
NZPO		DRAWN H.C.		CHECKED	WIRING	CIRCUIT		GBU 14610		