

5 Centimetres 10 15 20 25 30 35 40 45 50 55 60 65 70 75 80 85 90 95

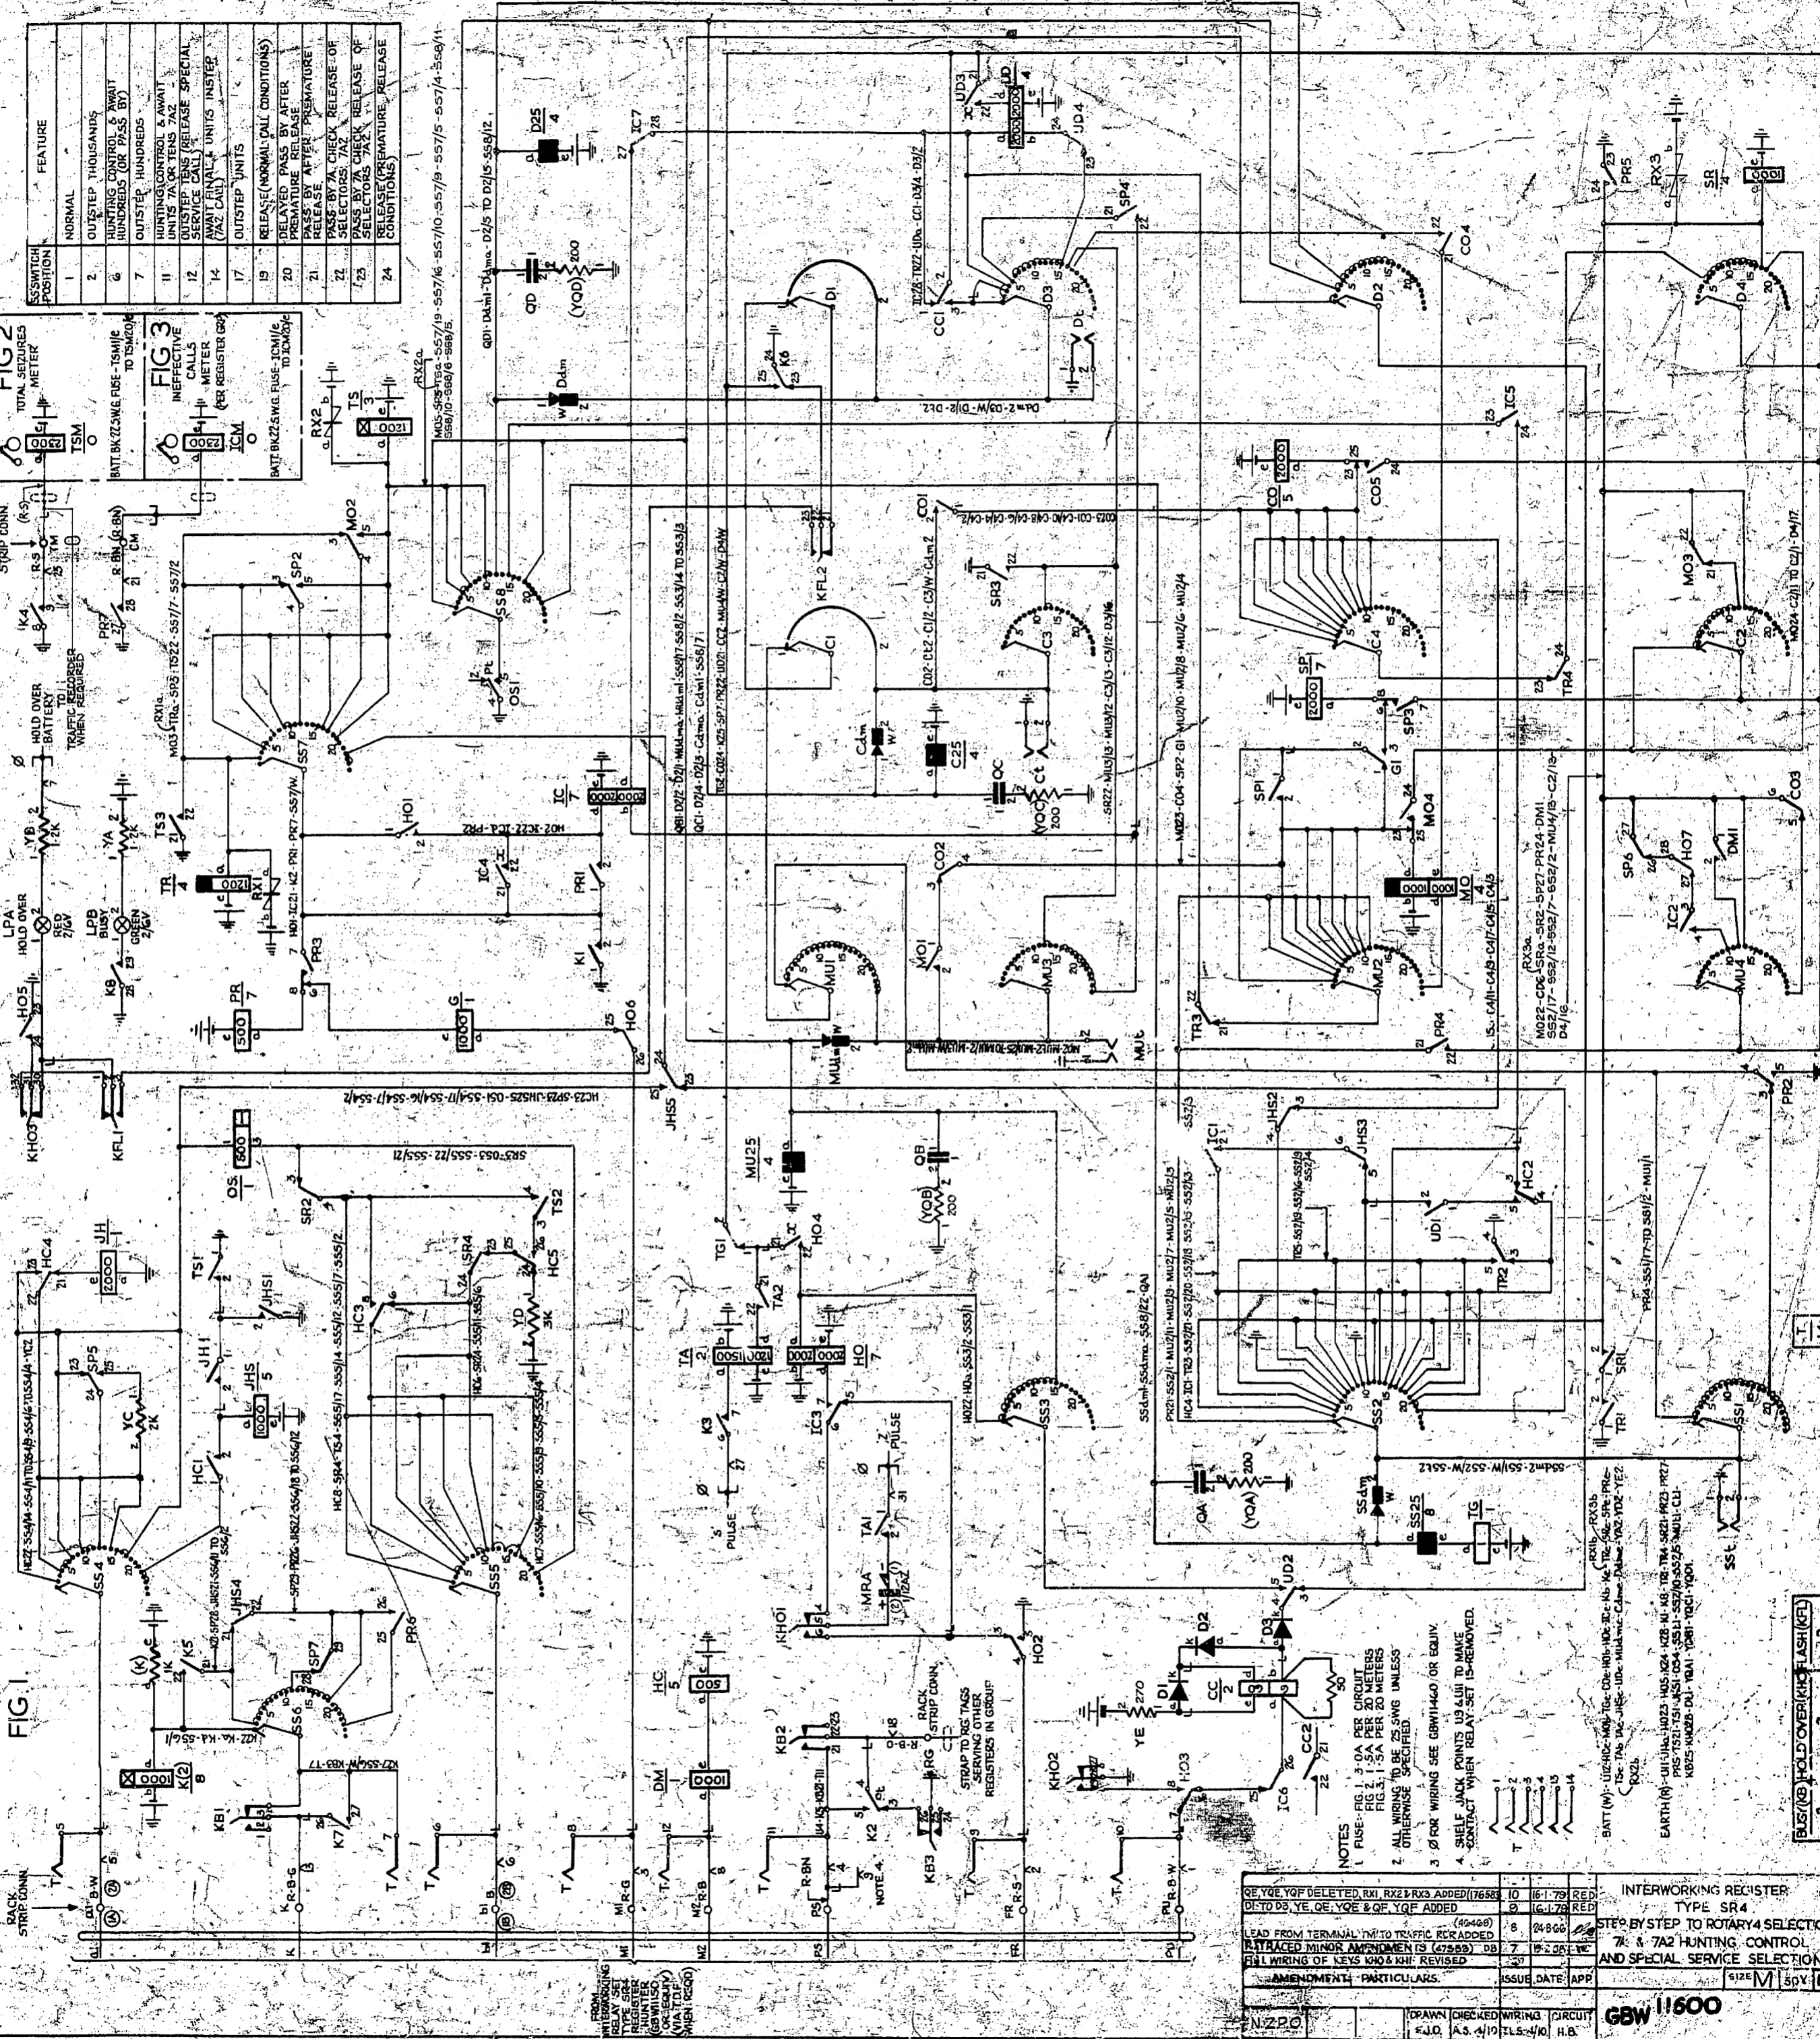


FIG 1

SSWITCH POSITION	FEATURE
1	NORMAL
2	OUTSTEP THOUSANDS
3	HUNTING CONTROL & AWAIT HUNDREDS (OR PASS BY)
6	OUTSTEP HUNDREDS
11	HUNTING CONTROL & AWAIT UNITS '7A OR TENS '7A2
12	OUTSTEP TENS (RELEASE SPECIAL SERVICE CALL)
14	AWAIT FINAL UNITS INSTEP (7A CALL)
17	OUTSTEP UNITS
19	RELEASE (NORMAL CALL CONDITIONS)
20	DELAYED PASS BY AFTER PREMATURE RELEASE
21	PASS BY AFTER PREMATURE RELEASE
22	PASS BY '7A CHECK RELEASE OF SELECTORS '7A2
23	PASS BY '7A CHECK RELEASE OF RELEASE (PREMATURE RELEASE CONDITIONS)

FIG 2

TOTAL SEQUIRES METER
 BATT BKZ2 SWG FUSE-TSM/IC TO TSM/IC

FIG 3

INEFFECTIVE CALLS METER (PER REGISTER GRD)
 BATT BKZ2 SWG FUSE-JCM/IC TO JCM/IC

NOTES

1. FUSE-FIG. 1, 3-0A PER CIRCUIT; FIG. 2, 1-5A PER 20 METERS; FIG. 3, 1-5A PER 20 METERS.
2. ALL WIRING TO BE 25 SWG UNLESS OTHERWISE SPECIFIED.
3. FOR WIRING SEE GBW11460 OR EQUIV.
4. SHELF JACK POINTS U9 & U10 TO MAKE CONTACT WHEN RELAY SET IS REMOVED.

RELAY (M) - U10-HAS-MU23-K05-K24-K28-MI-K8-TB-TBA-SR21-PR23-PR27
 PR5-TS21-TS1-TS11-DS4-SS11-SS21-SS22-SS25-MU11-CL1
 KR25-KR28-DJ1-Y0A1-Y0B1-Y0C1-Y0D1

BATT (W) - U12-H01-IC1-IC2-IC3-IC4-IC5-IC6-IC7-IC8-IC9-IC10-IC11-IC12-IC13-IC14-IC15-IC16-IC17-IC18-IC19-IC20-IC21-IC22-IC23-IC24-IC25-IC26-IC27-IC28-IC29-IC30-IC31-IC32-IC33-IC34-IC35-IC36-IC37-IC38-IC39-IC40-IC41-IC42-IC43-IC44-IC45-IC46-IC47-IC48-IC49-IC50-IC51-IC52-IC53-IC54-IC55-IC56-IC57-IC58-IC59-IC60-IC61-IC62-IC63-IC64-IC65-IC66-IC67-IC68-IC69-IC70-IC71-IC72-IC73-IC74-IC75-IC76-IC77-IC78-IC79-IC80-IC81-IC82-IC83-IC84-IC85-IC86-IC87-IC88-IC89-IC90-IC91-IC92-IC93-IC94-IC95-IC96-IC97-IC98-IC99-IC100

EARTH (M) - U10-HAS-MU23-K05-K24-K28-MI-K8-TB-TBA-SR21-PR23-PR27
 PR5-TS21-TS1-TS11-DS4-SS11-SS21-SS22-SS25-MU11-CL1
 KR25-KR28-DJ1-Y0A1-Y0B1-Y0C1-Y0D1

AMENDMENT PARTICULARS

NO.	DESCRIPTION	DATE	APP.
1	REVISION		
2	REVISION		
3	REVISION		
4	REVISION		
5	REVISION		
6	REVISION		
7	REVISION		
8	REVISION		
9	REVISION		
10	REVISION		

INTERWORKING REGISTER TYPE SR4

STEP BY STEP TO ROTARY SELECTION
 '7A & '7A2 HUNTING CONTROL AND SPECIAL SERVICE SELECTION

GBW 11500

DRAWN: P. J. D. CHECKED: A. S. 4/10/53. WIRING: T. L. S. 4/10/53. CIRCUIT: H. B.