


FIG. 1A. TEST DESK OR TEST RACK

FIG. 2. R.S.R.

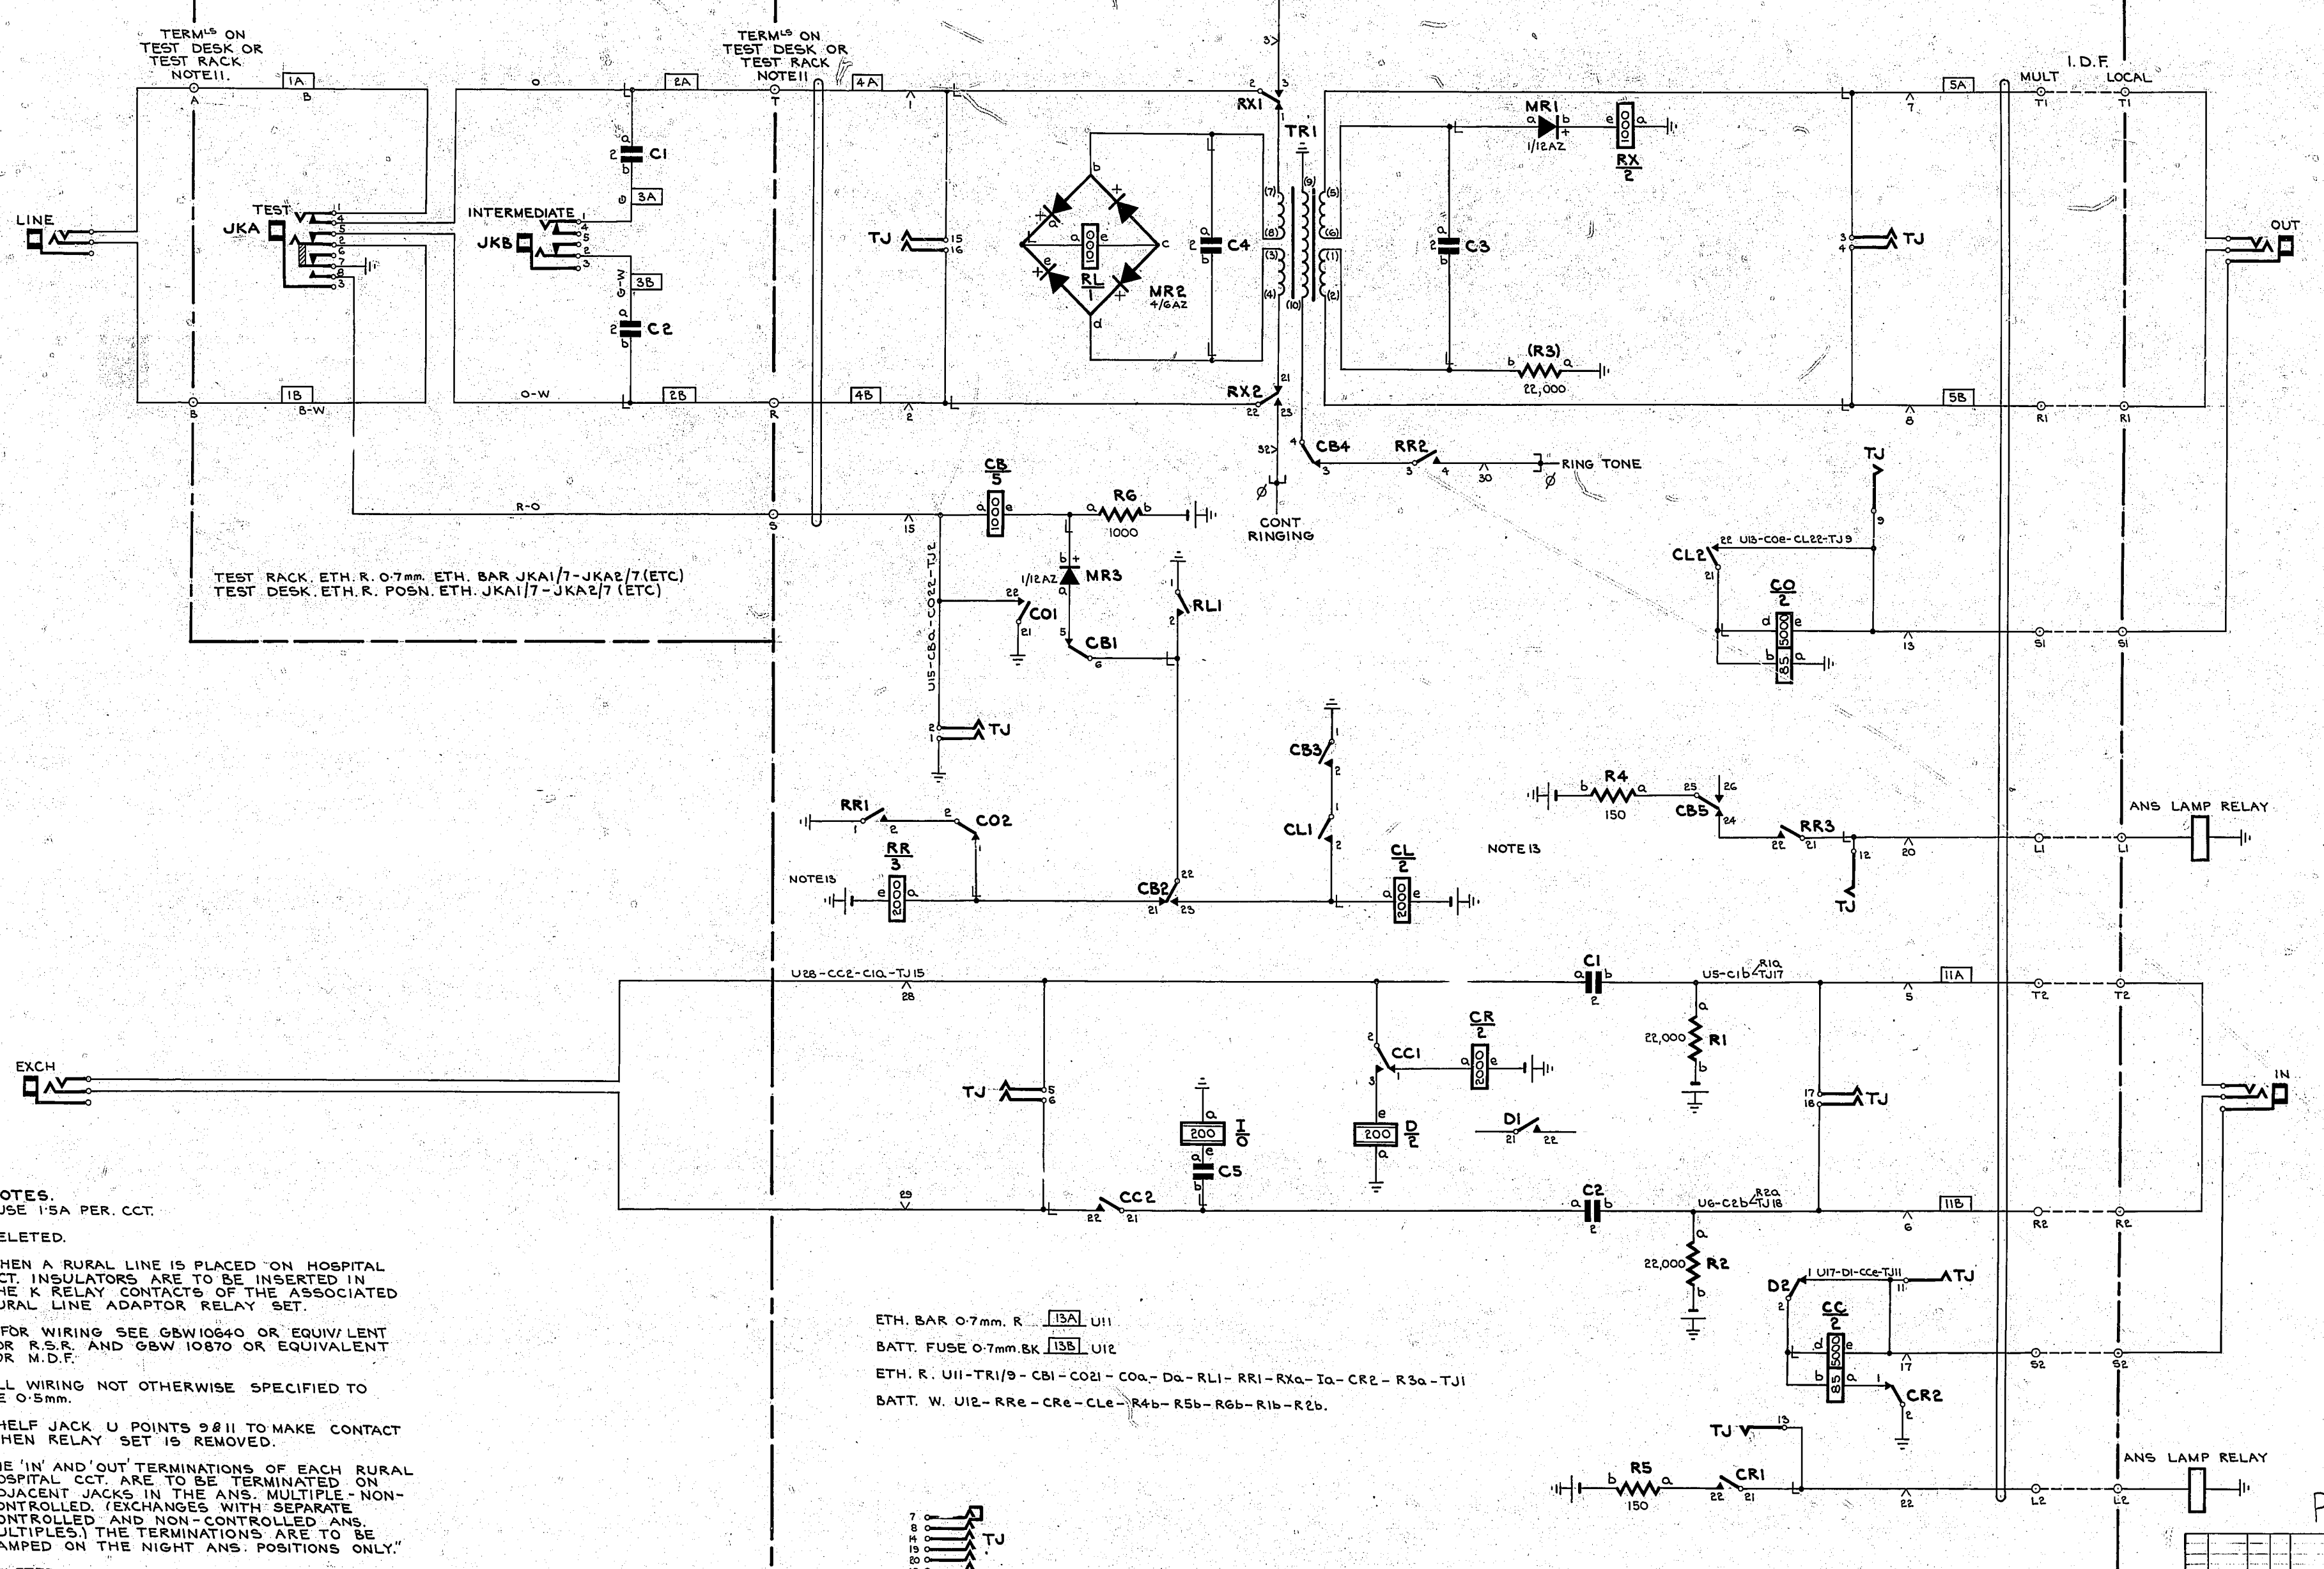


TEST RACK. ETH. R. 0.7mm. ETH. BAR JKA1/7-JKA2/7 (ETC)
 TEST DESK. ETH. R. POSN. ETH. JKA1/7-JKA2/7 (ETC)

NOTE 15

- NOTES.
- FUSE 1.5A PER. CCT.
 - DELETED.
 - WHEN A RURAL LINE IS PLACED ON HOSPITAL CCT. INSULATORS ARE TO BE INSERTED IN THE K RELAY CONTACTS OF THE ASSOCIATED RURAL LINE ADAPTOR RELAY SET.
 - FOR WIRING SEE GBW10640 OR EQUIV/ LENT FOR R.S.R. AND GBW 10670 OR EQUIVALENT FOR M.D.F.
 - ALL WIRING NOT OTHERWISE SPECIFIED TO BE 0.5mm.
 - SHELF JACK U POINTS 9&11 TO MAKE CONTACT WHEN RELAY SET IS REMOVED.
 - THE 'IN' AND 'OUT' TERMINATIONS OF EACH RURAL HOSPITAL CCT. ARE TO BE TERMINATED ON ADJACENT JACKS IN THE ANS. MULTIPLE-NON-CONTROLLED. (EXCHANGES WITH SEPARATE CONTROLLED AND NON-CONTROLLED ANS. MULTIPLES) THE TERMINATIONS ARE TO BE LAMPED ON THE NIGHT ANS. POSITIONS ONLY.
 - DELETED.
 - DELETED.
 - DELETED.
 - TEST RACK TERMINALS PROVIDED ONLY WHEN SPEC'D
 - DELETED.
 - ON EQUIPTS PRIOR TO ISSUE 4, EXTRA CONTACTS ON RELEASE CL & RR PROVIDED VC FACILITIES.

ETH. BAR 0.7mm. R. 13A U11
 BATT. FUSE 0.7mm. BK 13B U12
 ETH. R. U11-TR1/9 - CB1-CO2 - COa - Da - RL1 - RR1 - RXa - Ia - CR2 - R3a - TJ1
 BATT. W. U12 - RRc - CRc - CLc - R4b - R5b - R6b - R1b - R2b.

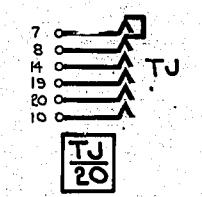

PROOF

ISS	DATE	DEL	DC	ORDER	CKD	APPD	CHANGE
DRNT-EQPT	CKD	ORIGIN T-EQPT					
TCD	L.N.	APPD	STANDARD ATW 22001				
NZPO ENGINEER-IN-CHIEF WELLINGTON							
				101	GBW12690		
				A1			

HOSPITAL CIRCUIT FOR RURAL
 AUTOMATIC LINES FOR USE
 AT EXCHANGES WITH A
 MANUAL BOARD 2000 TYPE

