

AS SEEN FROM REAR.

NOTE 1

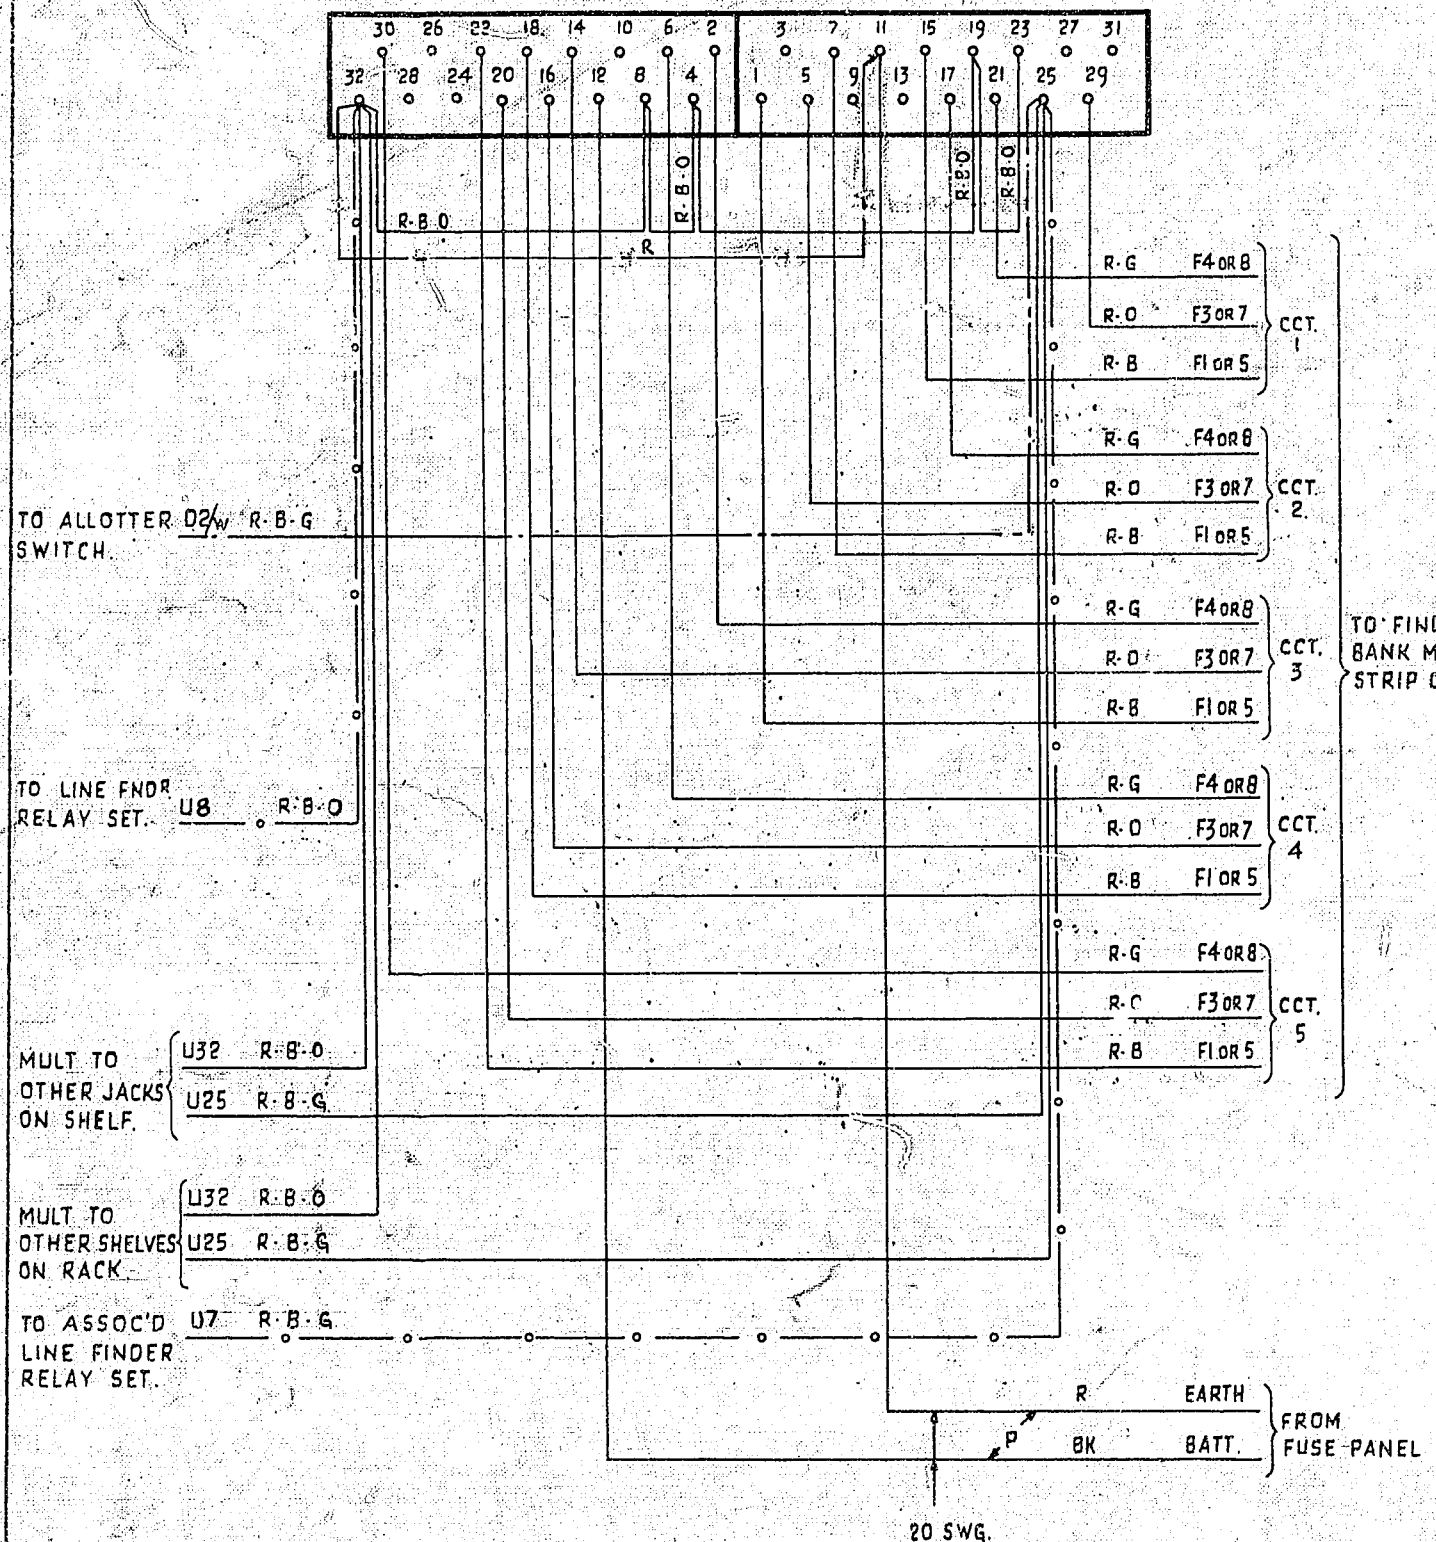


FIG. 1. SUBS TAPPING RELAY SET.

NOTES:-

1. JACK POINTS U2&4, U6&8, U9&11, U17&19, U21&23, U30&32 TO MAKE CONTACT WHEN RELAY SET IS REMOVED.
2. ALL WIRING TO BE 23 SWG. UNLESS OTHERWISE SPECIFIED.
3. WHEN ALLOTTER IS NOT FITTED OMIT CONNECTIONS SHOWN THUS & ADD CONNECTIONS SHOWN THUS .

AS SEEN FROM REAR.

NOTE 1

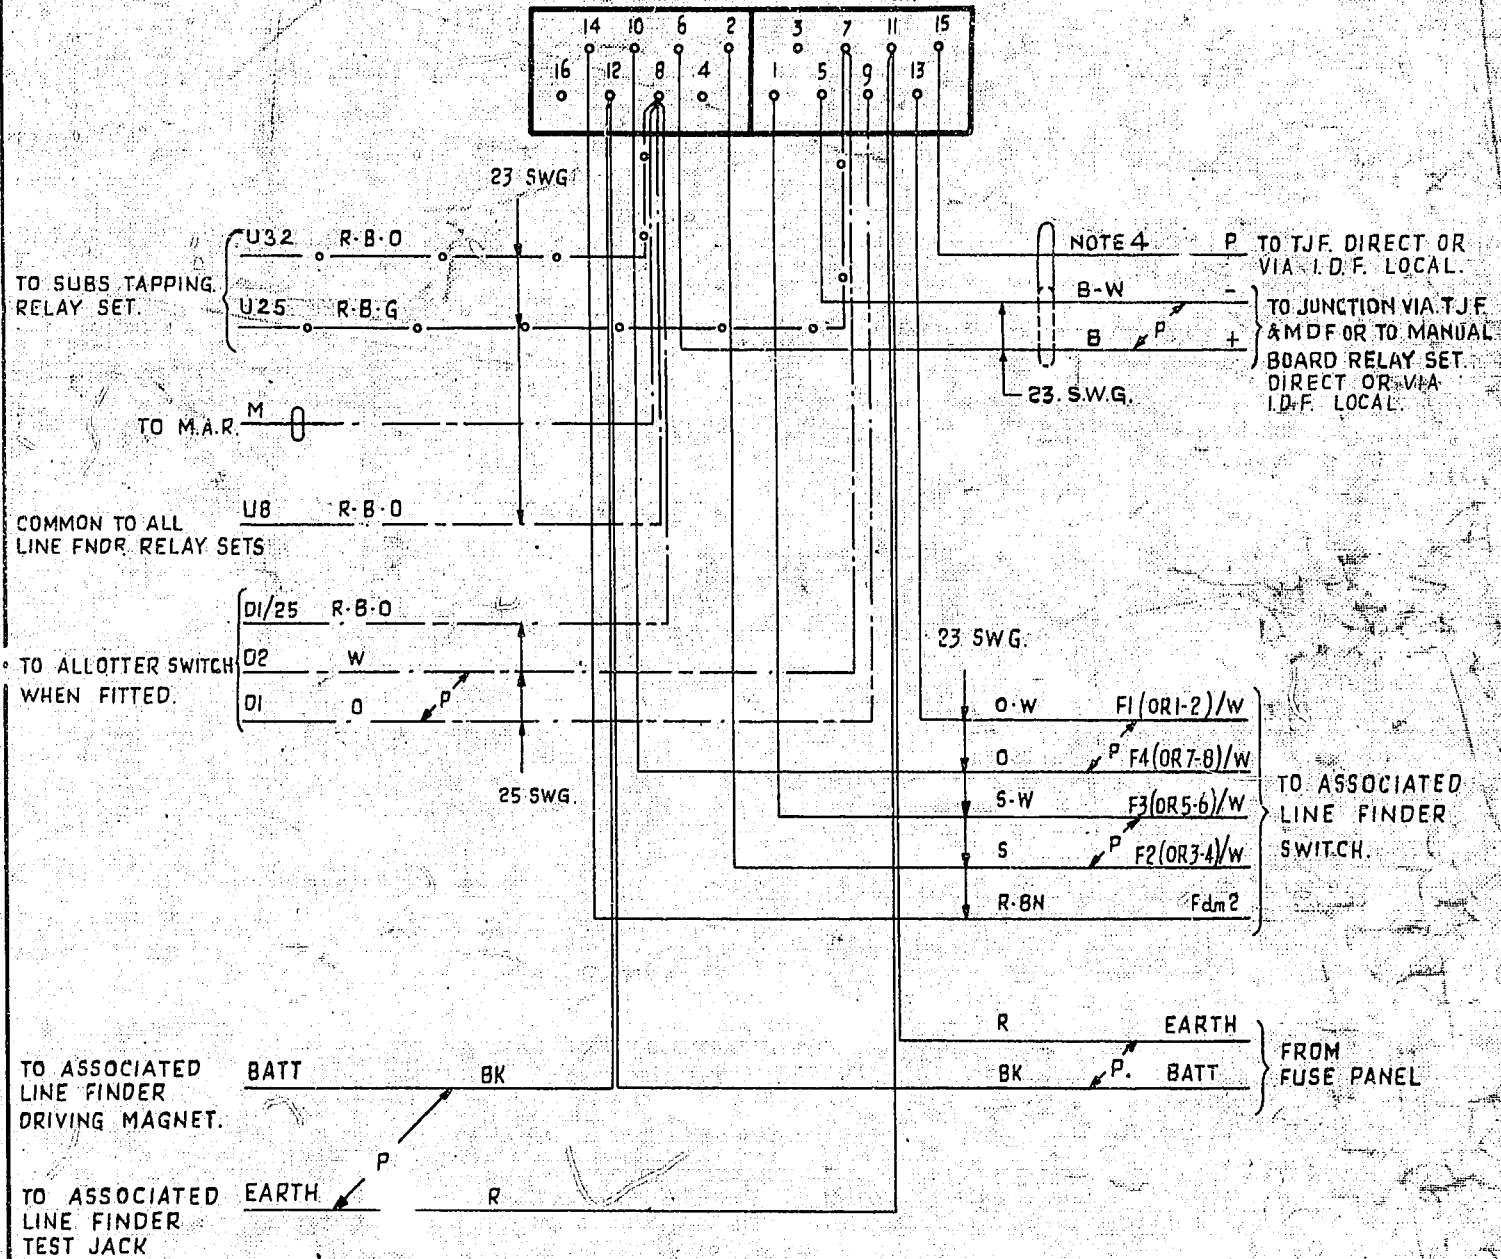


FIG. 2. LINE FINDER RELAY SET.

NOTES:-

1. JACK POINTS U9 & 11 TO MAKE CONTACT WHEN RELAY SET IS REMOVED.
2. ALL WIRING TO BE 20 SWG. UNLESS OTHERWISE SPECIFIED.
3. WHEN ALLOTTER IS NOT FITTED OMIT CONNECTIONS SHOWN THUS & ADD CONNECTIONS SHOWN THUS .
4. 'P' LEAD NOT REQUIRED WHEN CIRCUIT IS DIRECTLY CONNECTED TO MANUAL BOARD RELAY SET.

				CHANGED NUMBER CALLING EQUIPMENT.	
				TAPPING CIRCUIT & LINE FINDER.	
FIG. 2 RELS. U25 & 32 INTERCHANGED	(67740)	4	3.9.56	cur	
CONNECTIONS TO U25 & 32 FIG. 1. REVISED	(67746)	3	3.9.56	1/1	
FIG. 4. I.D.F. REFERENCES ADDED. NOTE 4. AMENDED.	(31667)	2	5.5.54	2/1	
		1	28.3.49		
AMENDMENT PARTICULARS	ISSUE	DATE	APP'D	50V	E
				GBU 10720	
N.Z. P.O.	DRAWN	CHECKED	WIRING	ENGINEER	

0
5 Centimetres
10
15
20
25
30