


AS SEEN FROM REAR

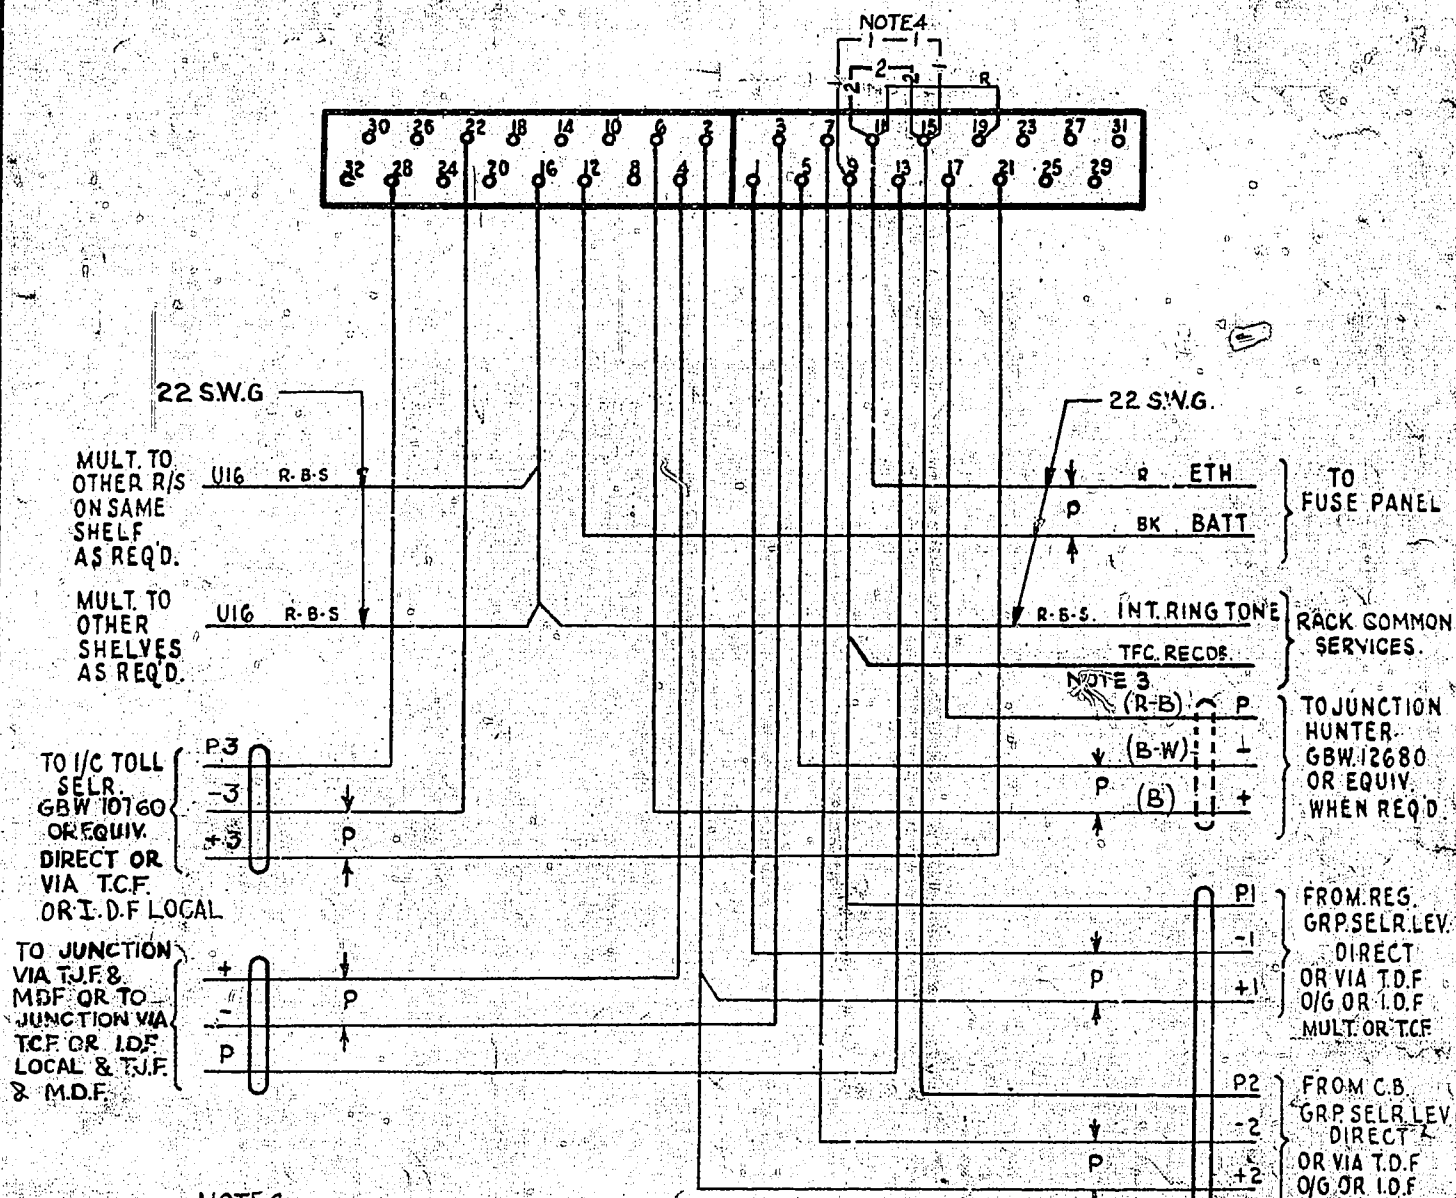

NOTES

- 1 SHELF JACK POINTS 9 & 11, 17 & 19 MAKE CONTACT WHEN RELAY SET IS REMOVED.
- 2 ALL WIRING 25 SWG UNLESS OTHERWISE SPECIFIED.
- 3 FOR COLOURS OF THESE LEADS SEE TABLE.
- 4 (a) WHEN RELAY SET IS AVAILABLE TO REGULAR AND CCB SELECTORS, STRAP U15 TO U9 THUS -1-1-
- (b) WHEN DIRECT CABLING FROM GROUP SELECTOR LEVEL IS USED AND THE RELAY SET IS AVAILABLE TO REGULAR SELECTORS ONLY, STRAP U15 TO U11 THUS -2-2-
- (c) WHEN DIRECT CABLING FROM GROUP SELECTOR LEVEL IS USED AND THE RELAY SET IS NOT EQUIPPED, STRAP U9 TO U11 TO U15 THUS -1-1- & -2-2-2-

1st PAIR OF SHELVES	R-O
2nd "	R-G
3rd "	R-BN
4th "	R-S
5th "	R-B-W

P1, P2 CONNECTIONS REVISED. NOTE 4 ADDED (5694)	3	22.7	AMB
ALT. WIRING FOR J.H. ADDED. TFC REC. OR TABLE REVISED (7217)	4	10.4.58	AMB
REF TO T.D.F. ADDED. T.C. TOLL SELR. (65701)	3	18.6.57	AMB
REFS TO T.C.F. ADDED (65988)	2	15.11.55	AMB
(31593)	1	4.5.54	AMB
AMENDMENT PARTICULARS	ISSUE	DATE	APP.
N.Z.P.O.	DRAWN	CHECKED	WIRING
	FIG.		CIRCUIT

BOTHWAY JUNCTION R/S
A.M.X - TOLL DEMAND
(FOR ORD & COINBOX SUBS)
2000 TYPE.

GBU.12280

5 Centimetres 10 15 20 25 30